

DEAD GOALIE MOTOR - DO NOT REPLACE UNTIL YOU CHECK THE BRUSHES!


During shipping, if the upper back assembly is dropped, the motor brushes can eject from their mounting. The motor will stop working if this occurs.

Before replacing motors, check the motor to ensure the two motor brushes have not ejected from their mounts.

To check, remove the black cover at the back.



You will see on each side the motor brush is held in by a spring. This motor brush has ejected from the mount.

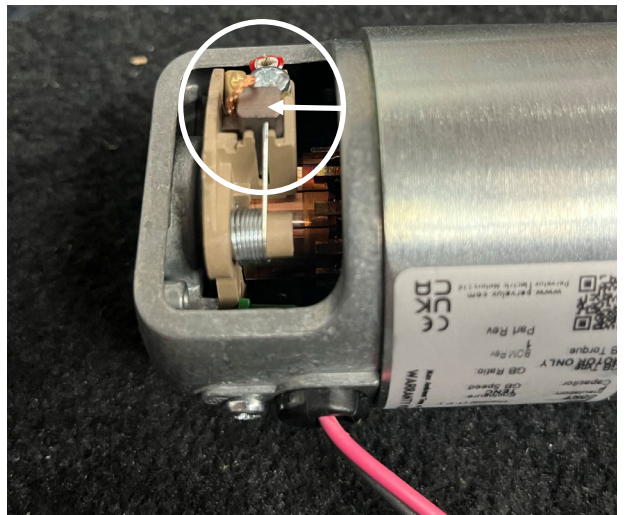

With your finger, push the motor brush back in. The spring should hold the motor brush firmly in the mount.

CHECK BOTH SIDES OF THE MOTOR!!

